

Resolved and known issues

Topic 70064 | Release Notes | IQ-Series Appliance | Updated: 9-Apr-2014

| | |
|--------------------|-----------------------------------|
| Applies to: | Websense IQ-Series appliance v1.2 |
|--------------------|-----------------------------------|

Resolved issues

The following issues have been resolved since the release of the Websense IQ-Series appliance v1.1:

Only the header and graphic at the top of the appliance notification could be customized. Other custom text changes in a notification did not display properly.

In Microsoft Internet Explorer, a user was not directed to an HTTPS web site target after clicking to accept the Confirm/Quota request.

The use of VLAN tags was not supported.

Invalid time zone values in the Websense blueSKY portal were not correctly interpreted by the appliance manager.

When multiple browser tabs were open to a Quota/Confirm page, and Confirm was clicked for 1 tab, the confirm code token was added to the second site's URL.

Adding a user-defined protocol did not succeed on the first attempt.

The upgrade log file was not available on the appliance **Configuration > Upgrade Management** page, in the Upgrade History table.

Known issues

The following issues are known to exist for the Websense IQ-Series appliance:

On the Configuration > Upgrade Management page, clicking a download or install upgrade icon does not change the Status column value for this item.

Workaround:

Click **F5** to refresh the page.

If a "Failed" status appears after a page refresh, please wait a few minutes, until the appliance restarts, and check the status again.

Upgrade status may display as "Failed" after a successful upgrade from version 1.1 to version 1.2.

Refreshing the appliance user interface immediately after the upgrade operation may cause incorrect error message displays.

Workaround:

Please wait approximately 5 minutes to refresh the user interface after the upgrade.

If the problem persists for longer than 5 minutes, please contact Websense Technical Support.

ICQ client traffic is not supported via port 443.

ICQ client connections are not allowed, even when the relevant protocol and category for ICQ traffic are allowed.

Workarounds:

One of 2 options is available:

- ◆ Define the ICQ server as a trusted destination in the Websense blueSKY portal (Network Devices appliance **Networking** tab).
- ◆ If the ICQ client includes port change support, switch to a port other than 443, ensuring that the port is not otherwise blocked by the appliance or a network firewall.

The Websense blueSKY Security Gateway transparent proxy does not work properly when located adjacent to an explicit proxy in a network.

One of 2 results occurs, depending on proxy location:

- ◆ If the explicit proxy is located between the client and the transparent proxy, then the transparent proxy's user identification process does not work. This deployment should be avoided.
- ◆ If the transparent proxy is located between the client and the explicit proxy, the authentication process cannot complete.

Workaround:

To resolve the second bullet issue above, include the appliance IP address in the individual browser's non-proxied destination list.

You can also disable the explicit proxy to allow the authentication process to complete.

The appliance may be difficult to register after it has first been deleted from the appliance list and then added again.

Workaround:

Contact Websense Technical Support for a workaround.

Multiple users can log on to the same server and be allowed to browse using another logged-on user's policy.

No workaround

A user may be allowed to transmit non-Web traffic before being authenticated for Web requests if the source IP address for the server is currently mapped to a different user.

No workaround

A Hebrew policy name may not be displayed correctly in a Websense blueSKY report's Detailed Summary table.

No workaround

Appliance alert format and phrasing may not be clear.

These alerts are only for Websense Technical Support representatives. You may disregard them.

Google Chrome and Mozilla Firefox do not support the Websense blueSKY Copy to Clipboard function.

No workaround

Web sites that use AJAX may display unexpected results when handling a Websense blueSKY block page (Quota or Confirmation).

No workaround

User Quota or Confirmation status may not be synchronized with the appliance when SSL traffic is routed to the Websense blueSKY portal.

If the Websense blueSKY cloud portal initiates a block page for an SSL traffic request, the cloud portal cannot update the appliance regarding the request status. The result is that Quota or Confirmation pages and time frames may not be aligned with the configured time frame parameters.

No workaround

Confirm page may appear embedded in a target site's web page.

No workaround

Custom block page notifications (confirm/quota/authentication) for the appliance and the cloud portal exhibit some display differences.

- ◆ Users with no web access permission receive a browser error rather than a block page when they tries to access an HTTPS web site
- ◆ A custom page configured with a language other than English is supported. However, multiple language configuration for a single page is not supported.

No workaround

Block pages may not be displayed as expected after the confirmation timeout expires for some SSL traffic requests.

Workaround:

Reopen the Web page to generate a new browsing session.

An HTTPS site request generates a continuous loop of Quota/Confirm page displays

Clicking **OK** only generates another Quota/Confirm page, with no access to the site.

This situation may occur when the appliance is configured to redirect SSL traffic to the cloud, and an appliance quota session for the same category has just expired.

Workaround:

Define a custom category for desired HTTPS sites and configure a Quota/Confirm action for the category.

Multiple simultaneous connections to the cloud portal may generate multiple Quota/Confirm page displays

Workaround:

Click **OK** on each Quota/Confirm page until the desired web site appears.

Authentication bypass for non-ASCII URLs or user agents is not supported.

No workaround

Google Chrome may block certain HTTPS sites to which it has pinned a certificate.

Workarounds:

- ◆ Import the Websense blueSKY Security Gateway default certificate to Chrome's CA storage location. (recommended)
- ◆ Use a browser other than Chrome. You will receive a warning message that allows you to click through and access the site.

The appliance does not detect NFS UDP packets and they are not processed.

TCP packets are correctly detected and processed.

No workaround

The appliance does not support oversized, non-standard frames (greater than 1500 bytes) for protocol detection.

Data transferred in these large frames is not processed by the appliance.

No workaround

Mobile traffic monitoring may not be supported.

Workaround:

Bypass traffic from WiFi networks that carry mobile traffic.

You might consider testing mobile traffic monitoring first and enabling the monitoring capability gradually in Websense blueSKY.

Creating protocol exception definitions that are identical except for the exception action should be avoided.

No workaround

A custom category that includes an HTTPS URL defined with a full path is not supported.

Destination IP address or a hostname for an HTTPS site are valid parameters.

No workaround

Incorrect screen may appear when the appliance cannot handle Java script properly.

No workaround

Appliance upgrade description does not appear in the cloud portal Upgrade Management table.

Workaround:

Find the upgrade description in the appliance **Configuration > Upgrade Management** page.

Clicking the “x” icon in an appliance pop-up alert may not close the window.

Workaround:

Click the **Close** button in the pop-up window.

A Google Chrome browser may display the “Who are you?” page after briefly displaying an authentication dialog box.

Workarounds:

- ◆ Click 1 of the following buttons to return to the authentication dialog box from the “Who are you?” page:
 - **Login** (if you have already registered your email address for Internet access)
 - **Register** (if you have not yet registered your email address)
- ◆ To avoid this issue, you can modify Chrome’s advanced settings:
 1. In the Chrome browser menu, select **Settings**.
 2. Click **Show advanced settings**.
 3. In the Privacy section, clear the **Use a prediction service to help complete searches and URLs typed in the address bar** check box.

Having more than 8 certificates in a chain may cause browsing problems in Google Chrome.

No workaround

A broken certificate chain may be rejected by the appliance but cause no visible error message in the cloud portal.

“Unknown CA” warnings may result from this situation.

Workaround:

Verify that your certificate chain is successfully uploaded.

Connectivity with appliance may be lost after changing the VLAN tag while connected to the appliance management interface.

Workaround:

Ensure that your client routing includes the new VLAN configuration to recover the connection.

Requests for the YouTube education page are not supported for SSL if SSL decryption for the category is not enabled.

No workaround